


A7-1460

ISSUE E

IF IN DOUBT-ASK


FIRST W.O.

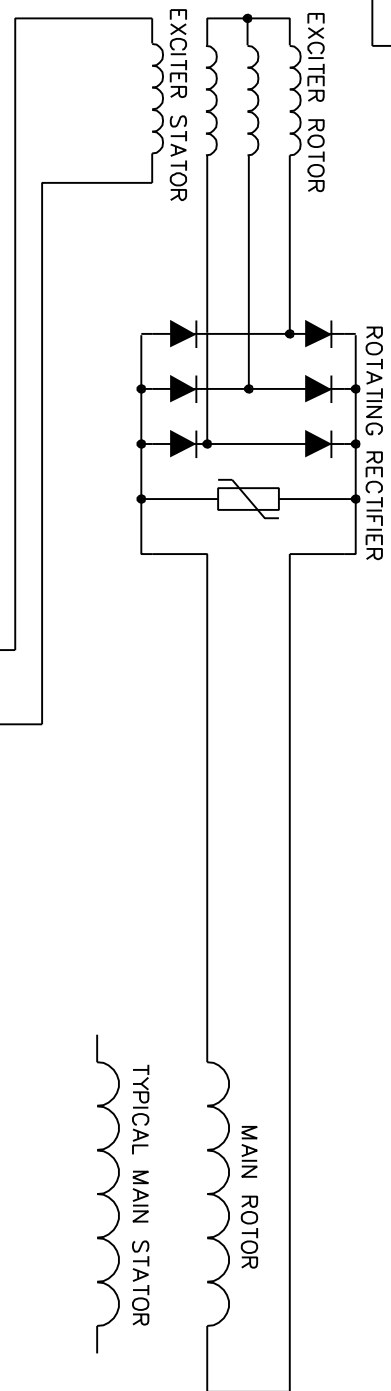

DETAILS OF THE MAIN STATOR AND MAIN TERMINAL CONNECTIONS ARE SHOWN ON SEPARATE WIRING DIAGRAM

APPROVED DOCUMENT

HAND TRIMMER (when required)
 REMOVE LINK 1-2 BEFORE CONNECTING
 USE TWO-CORE TWISTED-PAIR SCREENED CABLE (RATED 250Vdc/1A)
 CONNECT CABLE SCREEN TO GENERATOR FRAME/EARTH
 CLOCKWISE (CW) ROTATION INCREASES GENERATOR VOLTAGE

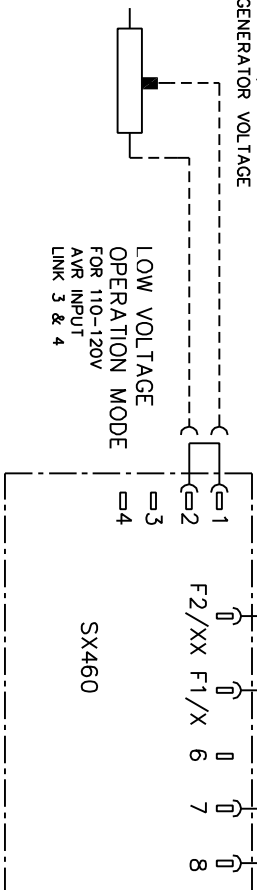

4-8664-01	E	USD	14.09.06	CHANGE OF COMPANY NAME
4-8167-01	D	AV	01:11:05	LEAD 6 REMOVED
4/6/702/03	C	GTK	27.10.2004	HAND TRIMMER NOTE AMENDED
3/9762	B	S.H.	4:1:95	LEAD 6 ADDED
3/8192	A	P.N.	5:1:93	ORIGINAL ISSUE
MOD.	ISS.	DRN.	DATE	ALTERATION

CERTIFIED PRINT (ONLY IF SIGNED)		FRAME	OTHER FEATURES	
BY		CONTROL	SERIES SX460	
DATE		NO. OF ENDS	2	
DRAWN	P.N.	05.01.93	SENSING	2
CHK'D	P.J.W.	30.10.06	PHASE	
APP'D	D.P.C.	30.10.06		
BASE DIAGRAM		A7-1460		
SHEET 1 OF 1 SHEETS		ISSUE E		